

REMEDIAL ACTION WORKPLAN ADDENDUM

**Allied Building Supplies
101 West Elizabeth Avenue
Linden, Union County, New Jersey**

**UST #0129486
Case #93-06-24-1425**

Prepared for:

**Mr. Daniel Winters
SELRITE Millwork Corporation
581 Rahway Avenue
Union, NJ 07083**

February 23, 1995

BRINKERHOFF ENVIRONMENTAL SERVICES, INC.
2430 HIGHWAY 34
BUILDING A, FIRST FLOOR
MANASQUAN, NEW JERSEY 08736
Tel: (908)223-2225 Fax: (908) 223-3666

BES Job #94139A

BRINKERHOFF

REMEDIAL ACTION WORKPLAN ADDENDUM

**Allied Building Supplies
101 West Elizabeth Avenue
Linden, Union County, New Jersey**

**UST #0129486
Case #93-06-24-1425**

Prepared for:

**Mr. Daniel Winters
SELRITE Millwork Corporation
581 Rahway Avenue
Union, NJ 07083**

February 23, 1995

TABLE OF CONTENTS

1.0 Introduction	1
2.0 Groundwater Investigation	1
2.1 Monitoring Well Installation and Repair	
2.2 Groundwater Sampling Procedures	
2.3 Groundwater Analytical Summary	
2.4 Site Hydrogeology	
3.0 Recommendations	3

Figures

Figure 1 - Site Location Map

Figure 2 - Site Plan Map

Figure 3 - Groundwater Contour Map

Exhibits

Exhibit I - Well Records, Form A and B

Exhibit II - Monitoring Well Sampling Data Form

Exhibit III - Laboratory Analytical Results

**Remedial Action Workplan Addendum
Allied Building Supplies
101 West Elizabeth Avenue
Linden, Union County, New Jersey**

**UST #0129486
NJDEP Case #93-06-24-1425**

February 23, 1995

1.0 Introduction

Brinkerhoff Environmental Services, Inc. (BES) was retained by SELRITE Millwork Corporation to prepare a Remedial Action Workplan (RAW) Addendum for Allied Building Supplies (Allied) in accordance with the August 12, 1994 NJDEP correspondence addressed to Mr. Daniel Winters of Allied. The site is located at 101 West Elizabeth Avenue, Linden, Union County (see Figure 1). The RAW Addendum included the installation of two (2) groundwater monitoring wells, groundwater sampling and laboratory analysis.

During previous site activities, the casing and upper two (2) feet of monitoring well MW-1 had been damaged. This well was repaired two weeks before sampling was performed.

The following report presents the results of the investigation, including a request for natural attenuation at this site.

2.0 Groundwater Investigation

2.1 Monitoring Well Installation and Repair

On November 30, 1994, two (2) four (4) inch PVC monitoring wells were installed at the site by Diamond Drilling Company, Inc. Monitoring well MW-5 was installed within the former UST excavation at the downgradient edge and MW-6 was installed downgradient of the former excavation (see Figure 2). Monitoring well records are included as Exhibit I of this report.

During previous site activities monitoring well MW-1 was damaged. On December 29, 1994, MW-1 was repaired by Diamond Drilling. The protective casing and upper two feet of solid PVC were repaired. With the exception of the upper two feet of the well, MW-1 was relatively free of debris. The well was purged to assure any debris in the well was removed.

Wells MW-1, MW-5 and MW-6 were surveyed to a site bench mark by a licensed surveyor. All six (6) wells are tied to the same benchmark. Certification Forms A and B are included in Exhibit I of this report.

2.2 Groundwater Sampling

On January 16, 1995, the six (6) monitoring wells located on the property were sampled by BES personnel in accordance with the May 1992 NJDEP *Field Sampling Procedures Manual*. The samples were collected within two feet of the static water level after purging the wells a minimum of three standing columns of water. The monitoring well samples were collected with a dedicated stainless steel and Teflon bailer which was laboratory cleansed, then transferred to sealed laboratory glassware suitable for volatile organic compounds and lead. Monitoring well data forms are included in Exhibit II of this report.

2.3 Groundwater Analytical Summary

The samples collected, designated MW-1 through MW-6 and a field and trip blank, were submitted to a New Jersey certified laboratory, Accredited Laboratories, Inc., for analysis. Samples were analyzed for volatile organic compounds with a forward library search (VO+10), MTBE, TBA, and lead. Laboratory analytical results are included as Exhibit III of this report and summarized in Table I, below.

TABLE I
Groundwater Sampling Results
Volatile Organic Compounds, MTBE, TBA and Lead
Allied Building Supply
January 16, 1995
(results in ppb)

ERRORS!

Sample ID	Benzene	Toluene	Ethylbenzene	Total Xylenes	MTBE	TBA	Lead	TIC's
MW-1	35	79	60	267	50U	50U	46	189.263
MW-2	5U	5U	5U	5/10U	50U	50U	10U	298.4
MW-3	5U	5U	5U	5/10U	50U	50U	10U	ND
MW-4	5U	5U	5U	5/10U	50U	50U	10U	ND
MW-5	5U	5U	5U	5/10U	50U	50U	12	ND
MW-6	5U	5U	5U	5/10U	50U	50U	15.8	ND
Field Blank	5U	5U	5U	5/10U	50U	50U	10U	ND
Trip Blank	5U	5U	5U	5/10U	50U	50U	-	ND
*NJDEP Standard	1	1,000	700	40	700	500	10	-

U-Not detected above instrument detection limit. Preceding number is detection limit; ND-Compound not detected; *NJDEP Class II-A Specific Groundwater Quality Criteria; Please note that MW-1 and MW-5 were inadvertently mislabeled during sampling activities. Corrections have been made on the attached laboratory data.

Volatile organic compounds and lead were detected in sample MW-1. Benzene was detected at a concentration of 35 parts per billion (ppb), total xylenes were detected at a concentration of 267 ppb, and lead was detected at a concentration of 46 ppb. Lead was also detected in samples MW-5 and MW-6 at concentrations of 12 ppb and 15 ppb, respectively. No other volatile organic compounds were detected, with the exception of trace levels of methylene chloride and acetone, common laboratory contaminants.

Groundwater sampling results show a decrease in the level of petroleum related compounds in MW-1 since the previous sampling event conducted by Vectre, Inc. in December 1993. The December 1993 sampling event reported benzene at 350 ppb, toluene at 7,500 ppb, ethylbenzene at 1,600 ppb and xylenes at 2,230 ppb.

2.4 Site Hydrogeology

Subsurface soil consists of red clayey fine sand with some medium coarse sand pebbles and shale fragments to a depth of 17.5 feet below grade, the maximum depth of stratigraphic section drilled.

Depth to groundwater ranged from 2.17 feet in MW-5 to 12.43 feet in MW-6. The shallow depth of groundwater in MW-5, located within the former UST excavation, is likely due to perched water within the former tank field area. Groundwater flow direction is toward the northeast as shown on Figure 3 - Groundwater Contour Map. A small anomaly in flow direction is present at MW-5. This well is located within the former tank excavation and shows a false high in depth to groundwater, caused by water perched within the former excavation. Monitoring well data is presented in Table II, below.

TABLE II
Monitoring Well Data
Allied Building Supply
January 16, 1995
(results in feet)

	MW-1	MW-2	MW-3	MW-4	MW-5	MW-6
Casing Elevation	29.23	30.29	27.98	28.19	29.71	30.60
Well Depth	15.15	19.55	14.45	19.45	12.61	17.09
Depth to Screen	2.98	N/A	N/A	N/A	N/A	7.52
Depth to Groundwater	9.76	11.11	8.18	8.49	2.17	12.43
Product Thickness	0.0	0.0	0.0	0.0	0.0	0.0
Groundwater Elevation	19.47	19.18	19.80	19.70	27.54	18.17

3.0 Recommendations

BES conducted a remedial investigation at Allied Building Supplies, which included the installation and sampling of groundwater monitoring wells.

Groundwater sampling results showed gasoline related volatile organic compounds in only one (1) of the six (6) monitoring wells on-site. Benzene was detected at 35 ppb and xylenes were detected at 267 ppb in well MW-1, which is located on the immediate upgradient edge of the former tank excavation. Monitoring wells MW-2, MW-5 and MW-6, located downgradient to slightly side gradient of the former UST excavation, reported no detectable gasoline related volatile organics.

Lead was detected in three (3) monitoring wells at levels ranging from 12 ppb in MW-5, 15 ppb in MW-6 and 46 ppb in MW-1.

BES recommends natural attenuation be considered as a mechanism for remediation at this site. Laboratory analytical data and site specific geologic and hydrogeologic conditions favor natural attenuation. Only one (1) well has shown localized levels of gasoline related volatile organics and no gasoline related volatile organics were detected in downgradient wells. The abundant clay in subsurface sediment and the perched water present within the former tank excavation suggest a slow groundwater flow rate at this site. The combination of both a limited extent of impacted groundwater and a slow migration rate indicate natural attenuation will be effective in preventing any off-site migration of contaminants.


An in-depth discussion of natural attenuation as an appropriate remedial method for this site is set forth in the Remedial Action Workplan dated May 1994, which was previously submitted to your attention.

This report was prepared and is respectfully submitted by:
Brinkerhoff Environmental Services, Inc.



Doug Harm, P.G.
Senior Consultant/Certified Geologist
NJDEP Subsurface Evaluator No. 650

2/22/95
Date

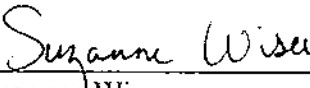

Suzanne Wiser
Environmental Scientist

2/23/95
Date

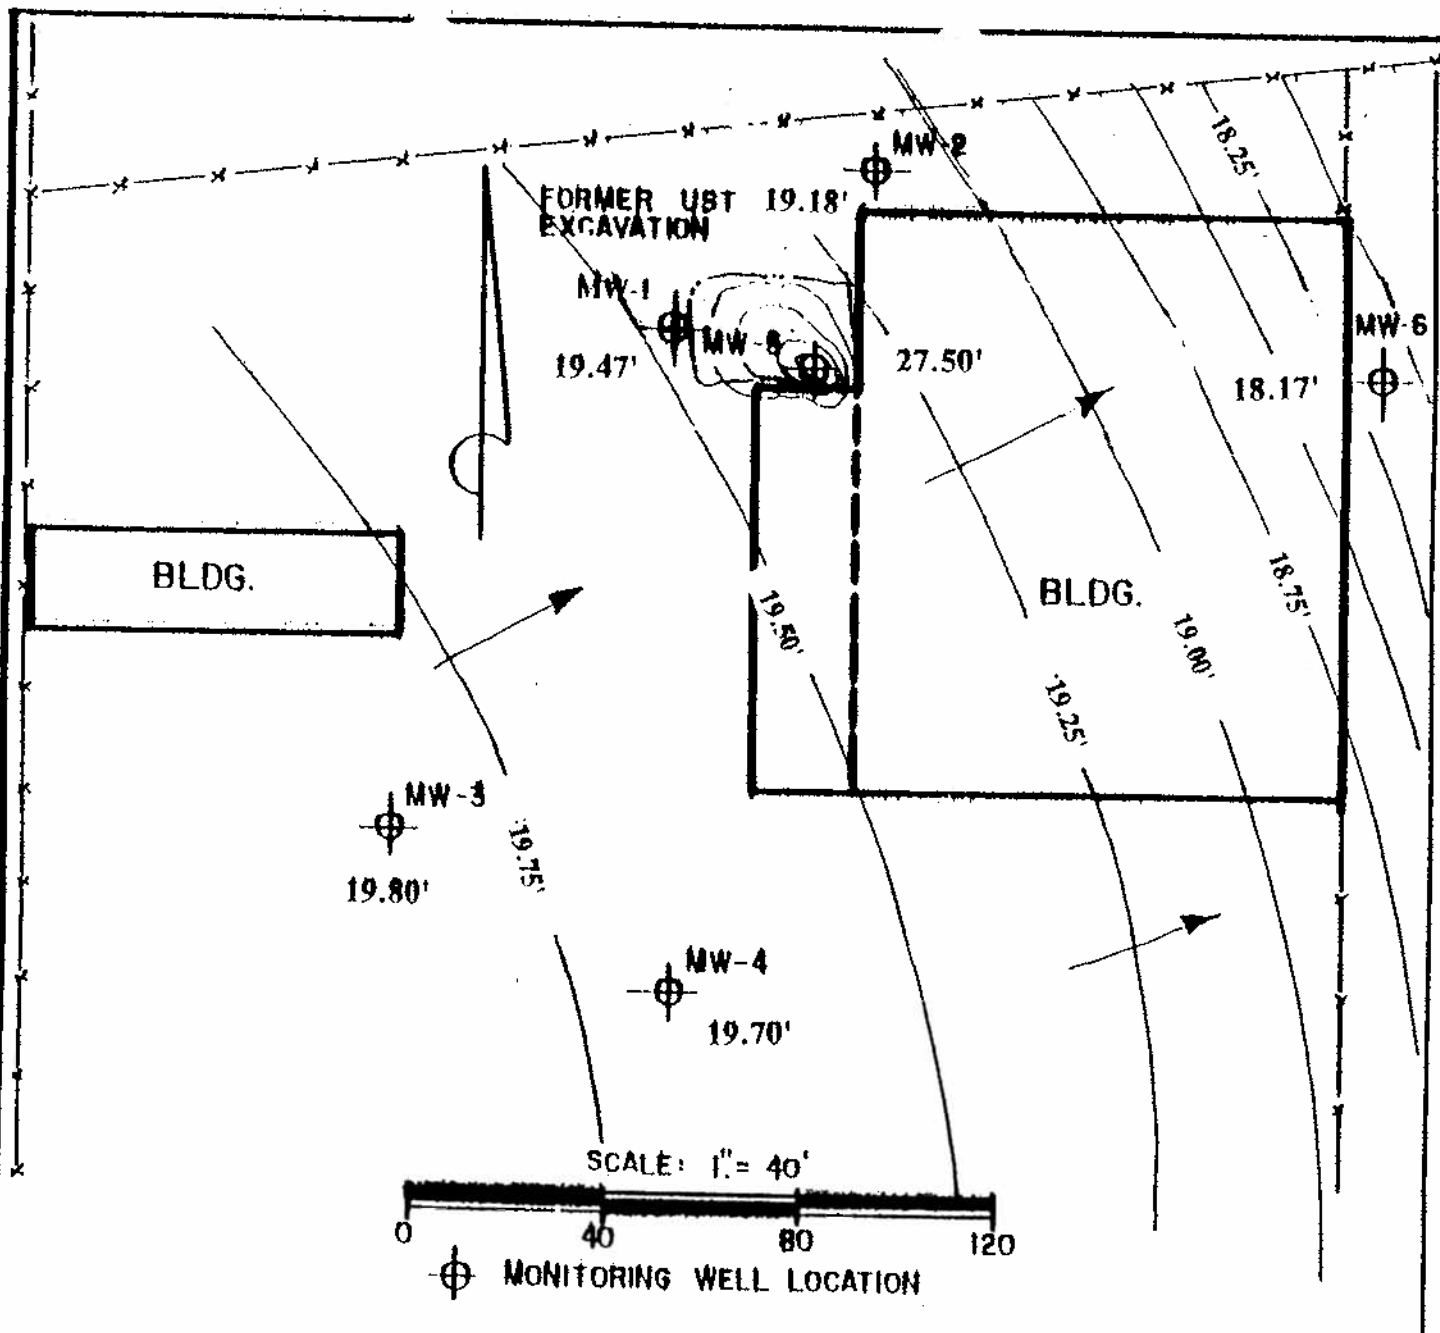


FIGURE 3
GROUNDWATER CONTOUR MAP
JANUARY 16, 1995

Allied Building Supply
101 West Elizabeth Ave.
Linden, New Jersey

Contour Interval = 0.25'

→ Groundwater Flow Direction

BRINKERHOFF ENVIRONMENTAL SERVICES, INC.

2430 HIGHWAY 34 - BLDG. A - 1st FLOOR
MANASQUAN, NEW JERSEY, 08738

JOB NUMBER

BES NO. 84-139A

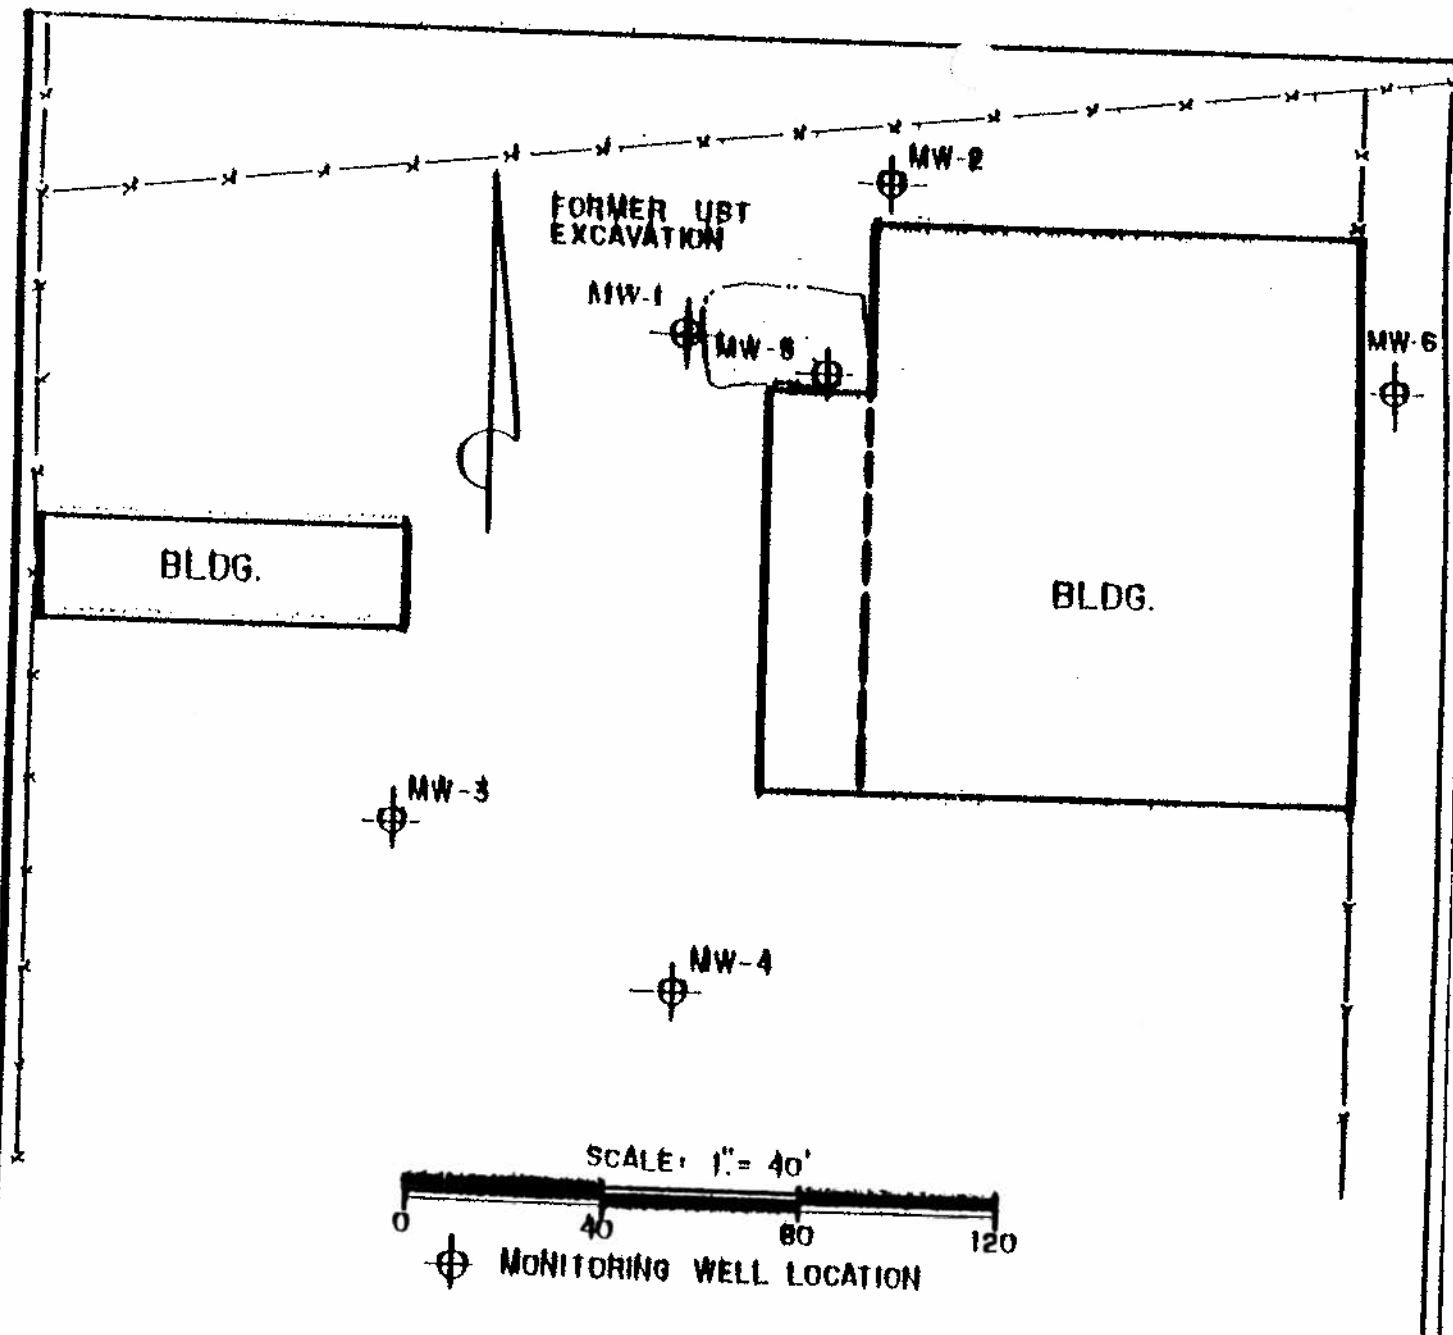


FIGURE 2

SITE PLAN MAP

Allied Building Supply
 101 West Elizabeth Ave.
 Linden, New Jersey

BRINKERHOFF ENVIRONMENTAL SERVICES, INC.

2430 Highway 34 - BLDG. A - 3RD FLOOR
 MANASQUAN, NEW JERSEY 08738

JOB NUMBER

GES NO. 94-139A

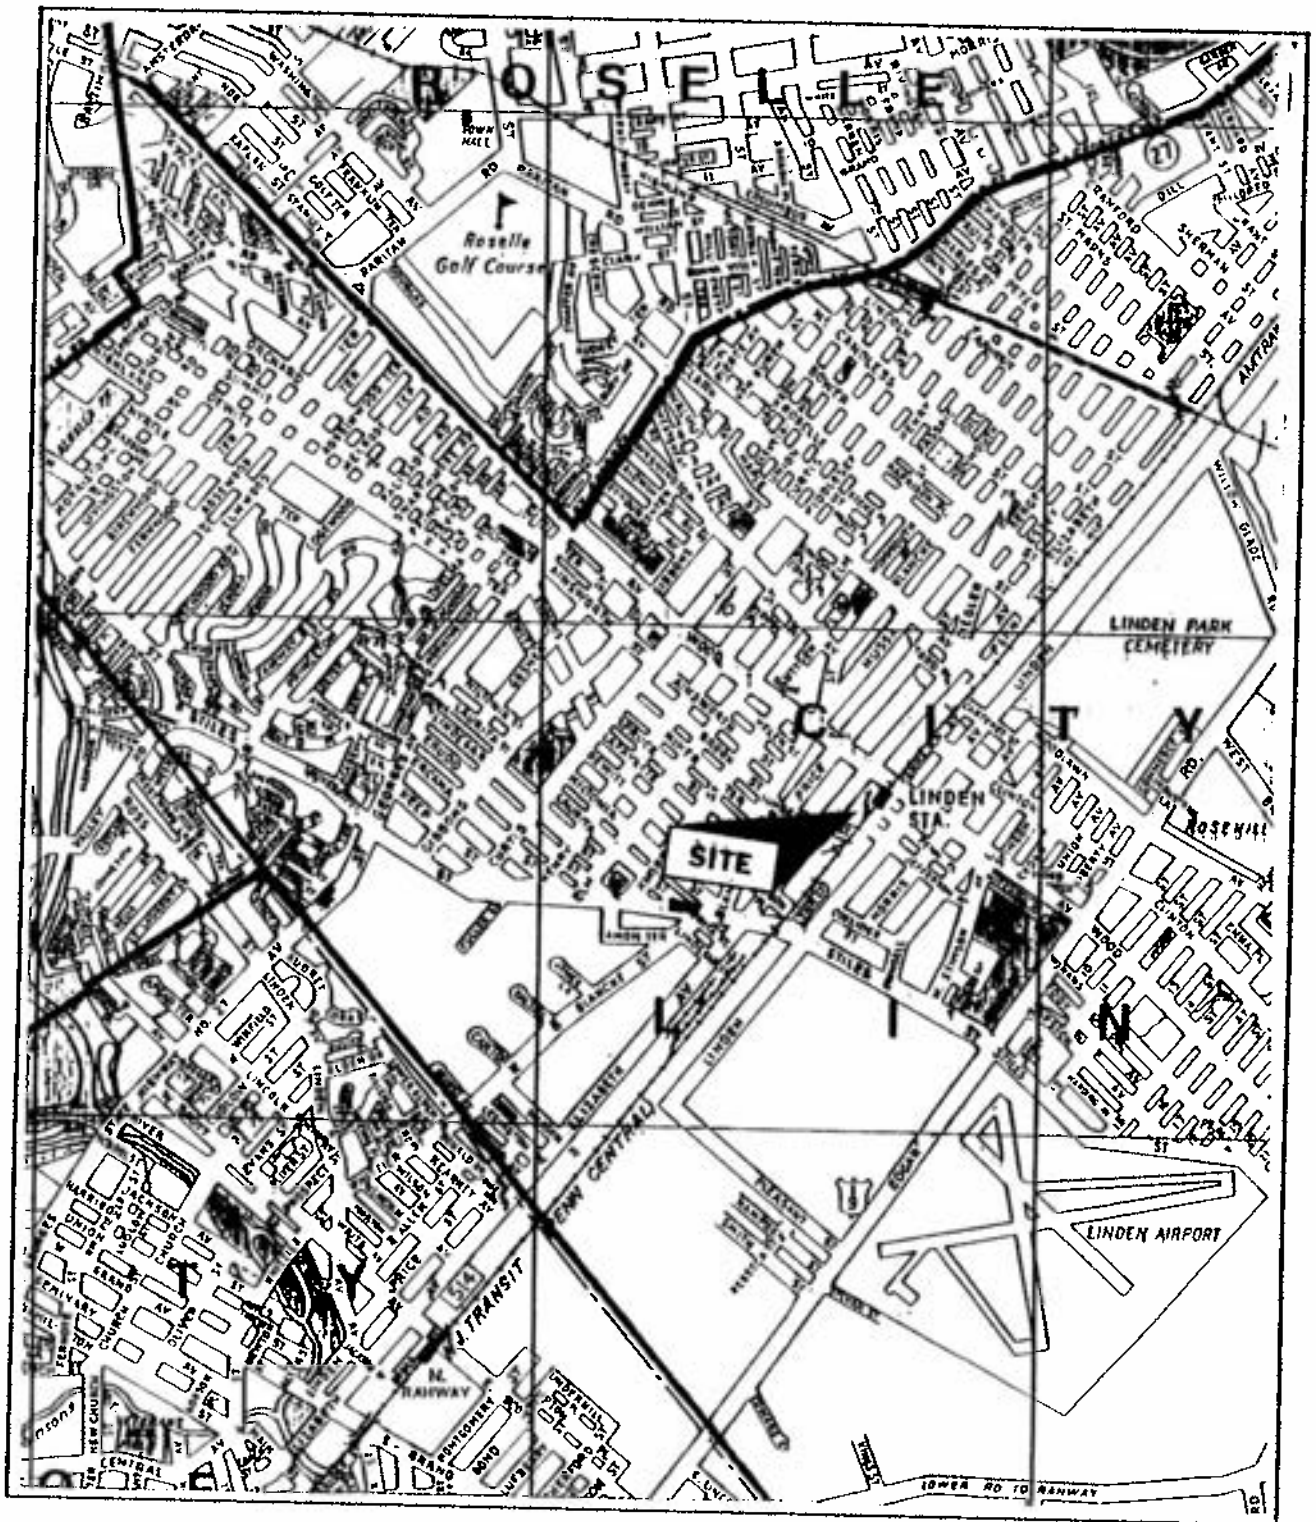


FIGURE 1
SITE LOCATION MAP
UNION COUNTY HAGSTROM
SCALE 1" = 2,000'

New Jersey Department of Environmental Protection and Energy
Bureau of Water Allocation

MONITORING WELL RECORD

Well Permit No. 26 - 38051
Atlas Sheet Coordinates 28 31 322 ☐OWNER IDENTIFICATION - Owner SELTZ WILSON CORP
Address 581 RAYWAY AVENUE P.O. BOX 387
City UNION State NJ Zip Code 07083WELL LOCATION - If not the same as owner please give address. Owner's Well No. 11105
County UNION Municipality LINDEN CITY Lot No. 10 Block No. 104
Address 101 W. ELIZABETH AVE., LINDEN, NJ 07036TYPE OF WELL (as per Well Permit Categories) MONITORING Date well completed 11/30/94
Regulatory Program Requiring Well NET Case I.D. # 93-00-24-1425CONSULTING FIRM/FIELD SUPERVISOR (if applicable) BRINKERHOFF INC. Tele. # 908-223-2225

WELL CONSTRUCTION

Total depth drilled 12.98 ft.Well finished to 12.98 ft.

Borehole diameter:

Top 10 in.Bottom 10 in.Well was finished: ☐ above grade
☒ flush mountedIf finished above grade, casing
height (stick up) above land
surface ft.

Was steel protective casing installed?

☐ Yes ☒ NoStatic water level after drilling 3 ft.Water level was measured using TAPEWell was developed for 5 hours at NA gpmMethod of development DIAPHRAGM PUMPWas permanent pumping equipment installed? ☐ Yes ☒ NoPump capacity gpmPump type: Drilling Method AUGERDrilling Fluid WATER Type of Rig CONE STName of Driller M. H. BRINKERHOFFHealth and Safety Plan submitted? ☐ Yes ☒ NoLevel of Protection used on site (circle one) None (D) C B AN.J. License No. 1237Name of Drilling Company DIAMOND DRILLING CO., INC.

	Depth to Top (ft.) [From land surface]	Depth to Bottom (ft.)	Diameter (inches)	Type and Material
Inner Casing	<u>NONE</u>			
Outer Casing (Not Protective Casing)	<u>2.27</u>	<u>2.98</u>	<u>4</u>	<u>Sched. 40 PVC</u>
Screen (Note slot size)	<u>2.98</u>	<u>12.98</u>	<u>4</u>	<u>Sched. 40 PVC (1/2")</u>
Tail Piece	<u>NONE</u>			
Gravel Pack	<u>2.00</u>	<u>12.98</u>	<u>10</u>	<u>MCKIE #1</u>
Annular Seal/Grout	<u>0</u>	<u>2.00</u>	<u>10</u>	<u>NEAT CEMENT</u>
Method of Grouting	<u>PRESSURE</u>			

GEOLOGIC LOG

(Copies of other geologic logs and/or
geophysical logs should be attached.)

0'-12.98' Red clayey
Fine sand with
some med.
coarse sand
and pebbles

I certify that I have drilled the above-referenced well in accordance with all well permit requirements and all applicable
State rules and regulations.Driller's Signature [Signature]Date 11-30-94

COPIES: White & Green - DEPE Canary - Driller Pink - Owner Goldenrod - Health Dept.

New Jersey Department of Environmental Protection and Energy
Bureau of Water Allocation

MONITORING WELL RECORD

Well Permit No. 26 - 38042
Atlas Sheet Coordinates 26 : 31 : 322 ☐OWNER IDENTIFICATION - Owner SHREVE MILWAUKEE CORPORAT
Address 581 RAINWAY AVENUE P.O. BOX 387
City UNION State NJ Zip Code 07083WELL LOCATION - If not the same as owner please give address. Owner's Well No. MW 6
County UNION Municipality LINDEN CITY Lot No. 10 Block No. 254
Address 101 W ELIZABETH AVE., LINDEN, NJ 07036TYPE OF WELL (as per Well Permit Categories) MONITORING Date well completed 11/30/94
Regulatory Program Requiring Well DEP Case I.D. # 03-06-2A-1625CONSULTING FIRM/FIELD SUPERVISOR (if applicable) BRINKHOFF ENV. Tele. # 908-223-2225

WELL CONSTRUCTION

Total depth drilled 17.52 ft.Well finished to 17.52 ft.

Borehole diameter:

Top 10 in.Bottom 10 in.Well was finished: ☐ above grade☒ flush mountedIf finished above grade, casing
height (stick up) above land
surface _____ ft.

Was steel protective casing installed?

☐ Yes ☒ NoStatic water level after drilling 12.50 ft.Water level was measured using ELEC. PROBEWell was developed for 5 hours at NA gpmMethod of development DIAPHRAGM PUMPWas permanent pumping equipment installed? ☐ Yes ☒ No

Pump capacity _____ gpm

Pump type: _____

Drilling Method TUBERDrilling Fluid WATER Type of Rig CHESSName of Driller M. J. BRINKHOFFHealth and Safety Plan submitted? ☐ Yes ☒ NoLevel of Protection used on site (circle one) None D C B AN.J. License No. 1237Name of Drilling Company DIAMOND DRILLING CO., INC.

I certify that I have drilled the above-referenced well in accordance with all well permit requirements and all applicable State rules and regulations.

Driller's Signature [Signature]Date 11-30-94

COPIES: White & Green - DEPE Canary - Driller Pink - Owner Goldenrod - Health Dept.

	Depth to Top (ft.) [From land surface]	Depth to Bottom (ft.)	Diameter (inches)	Type and Material
Inner Casing	<u>NONE</u>			
Outer Casing (Not Protective Casing)	<u>.38</u>	<u>7.52</u>	<u>4</u>	<u>Sched. 40 PVC</u>
Screen (Note slot size)	<u>7.52</u>	<u>17.52</u>	<u>4</u>	<u>Sched. 40 PVC (.02)</u>
Tail Piece	<u>NONE</u>			
Gravel Pack	<u>5.50</u>	<u>17.52</u>	<u>10</u>	<u>Medium #1</u>
Annular Seal/Grout	<u>0</u>	<u>5.50</u>	<u>10</u>	<u>NEAT CEMENT</u>
Method of Grouting	<u>PRESSURE</u>			

GEOLOGIC LOG

(Copies of other geologic logs and/or geophysical logs should be attached.)

0' - 5' Brown clay loam
5' - 17.52' Red clayey
fine sd with
some med.,
coarse sand
and pebbles.

DWR-133M (7/92)

SERIAL # 38757

STATE OF NEW JERSEY
DEPARTMENT OF ENVIRONMENTAL PROTECTION AND ENERGY
TRENTON, NJ

Permit No. 2003

Water Allocation
CN 029
Trenton, N.J. 08625

MONITORING WELL PERMIT

VALID ONLY AFTER APPROVAL BY THE D.E.P.E.

COORD #: 01.01.01.01


Owner SELRITE Millwork Corporation
Address 581 Parkway Avenue P.O. Box 387
Union, NJ 07083Driller Diamond Drilling Company
Address 339 South Stump Tavern Road
Jackson, NJ 08527Name of Facility Allied Building Supply
Address 101 West Elizabeth Avenue
Linden, NJ 07036

Diameter of Well(s)	4	Inches	Proposed Depth of Well(s)	20	feet
# of Wells Applied for (max. 10)	2		Will pumping equipment be installed? YES ☐ NO ☒		
Type of Well (see reverse)	Monitoring		If Yes, give pump capacity		


LOCATION OF WELL(S)

Lot #	Block #	Municipality	County
10	254	Linden	Union

State Atlas Map No. 26

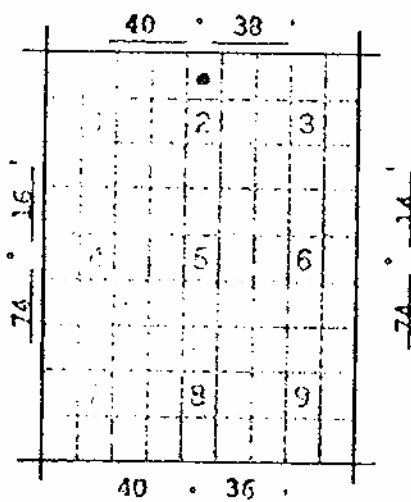

Draw sketch of well(s) nearest roads, buildings, etc. with marked distances in feet. Each well MUST be labeled with a name and/or number on the sketch.

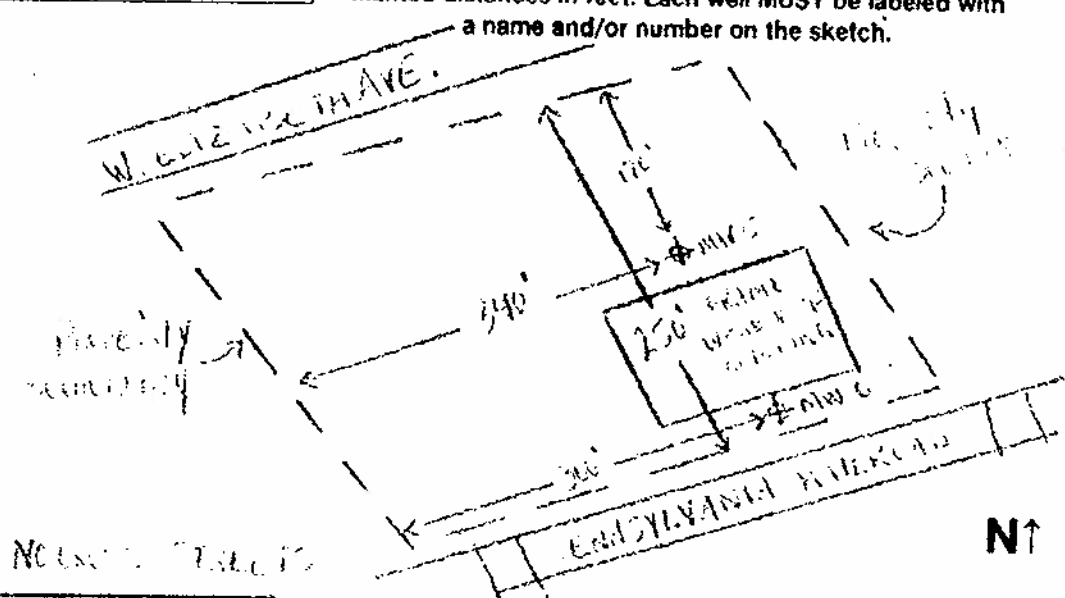


FOR MONITORING WELLS, RECOVERY WELLS, OR PIEZOMETERS, THE FOLLOWING MUST BE COMPLETED BY THE APPLICANT. PLEASE INDICATE WHY THE WELLS ARE BEING INSTALLED:

- ☐ Spill Fund Case
☐ ECRA Case
☐ CERCLA (Superfund) Site
☐ RCRA Site
☒ Underground Storage Tank
☐ NJPDES Municipal Discharge Permit
☐ NJPDES Industrial Discharge Permit
☐ Water and Hazardous Waste Enforcement Case
☐ Water Supply Aquifer Test Observation Well
☐ Other (explain) _____

Case I.D. Number

93-06-24-1425

This Space for Approval Stamp

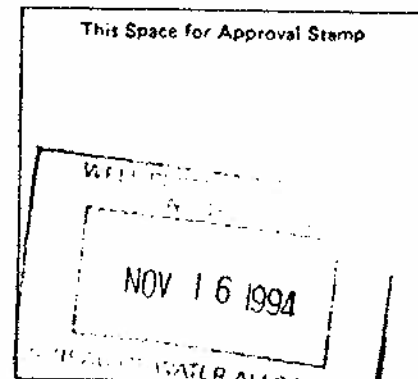FOR
D.E.P.E.
USE
☒ Issuance of this permit is subject to the conditions attached. (see next page)
☐ For monitoring purposes only

☒ The well(s) may not be completed with more than 25 feet of total screen or uncased borehole.

SEE REVERSE SIDE FOR IMPORTANT PROVISIONS AND REGULATIONS PERTAINING TO THIS PERMIT.

In compliance with N.J.S.A. 58:4A-14, application is made for a permit to drill a well as described above.

Date November 10, 1994

Signature of Driller

Signature of Owner

Health Dept.

Valley

Owner

Bliss

Driller

License # 31496

COPIES:

Water Allocation as White and Pink

MONITORING WELL CERTIFICATION - FORM A - AS-BUILT CERTIFICATION
(One form must be completed for each well)

Name of Owner: Selrite Millwork Corp.
Name of Facility: Allied Building Supply
Location: 101 West Elizabeth Ave., Linden, NJ
UST Registration No.: 0129486 BUST case No.: 93 .06 .24 .1425


CERTIFICATION

Well Permit Number: 2 6 . 3 8 8 5 1 .
Owner's Well Number (As shown on the application or plans): MW-5
Well Completion Date: 11/30/94
Distance from Top of Casing (cap off) to ground surface (one-hundredth of a foot): 0.00
Total Depth of Well to the nearest 1/2 foot: 12.98
Depth to Top of Screen (or Top of Open Hole) From Top of Casing (one-hundredth of a foot): 2.98
Screen Length (or length of open hole) in feet: 10'
Screen or Slot Size: 020
Screen or Slot Material: PVC
Casing Material: (PVC, Steel or Other-Specify): PVC
Casing Diameter (inches): 4"
Static Water Level From Top of Casing at the Time of Installation (one-hundredth of a foot): 2.61
Yield (gallons per minute): 1-2 GPM
Development Technique (specify): pump
Length of Time Well is Developed/
Pumped or Bailed: Hours 30 Minutes
Lithologic Log: Attach

Authentication

I certify under penalty of law that I have personally examined and am familiar with the information submitted in this document and all attachments and that, based on my inquiry of those individuals immediately responsible for obtaining the information, I believe the submitted information is true, accurate and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment.

Doug Harm
Name (Type or Print)
P.G. 238 State of PA
Certification or License No.

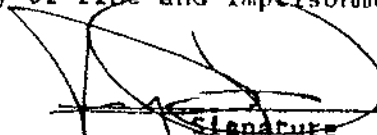
Signature
Seal

Certification by Executive Officer or Duly Authorized Representative

Name (Type or Print)

Title

Signature

Date

MONITORING WELL CERTIFICATION - FORM A - AS-BUILT CERTIFICATION
(One form must be completed for each well)

Name of Owner: Selrite Millwork Corp.
Name of Facility: Allied Building Supply
Location: 101 West Elizabeth Ave., Linden, NJ
UST Registration No.: 0129486 BUST case No.: 93 - 06 - 24 - 1425


CERTIFICATION

Well Permit Number: 2 6 - 3 8 8 5 2 -
Owner's Well Number (As shown on the application or plans): MW-6
Well Completion Date: 11/30/94
Distance from top of Casing (cap off) to ground surface (one-hundredth of a foot): 0.00
Total Depth of Well to the nearest 1/2 foot: 17.52
Depth to Top of Screen (or Top of Open Hole) From Top of Casing (one-hundredth of a foot): 7.52
Screen Length (or length of open hole) in feet: 10'
Screen or Slot Size: 020
Screen or Slot Material: PVC
Casing Material: (PVC, Steel or Other-Specify): PVC
Casing Diameter (inches): 4"
Static Water Level From Top of Casing at the Time of Installation (one-hundredth of a foot): 12.43
Yield (gallons per minute): 1-2 GPM
Development Technique (specify): pump
Length of Time Well is Developed/ Pumped or Bailed: Hours 30 Minutes
Lithologic Log: Attach

Authentication

I certify under penalty of law that I have personally examined and am familiar with the information submitted in this document and all attachments and that, based on my inquiry of those individuals immediately responsible for obtaining the information, I believe the submitted information is true, accurate and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment.

Doug Harm
Name (Type or Print)
P.G. 238 State of PA
Certification or License No.

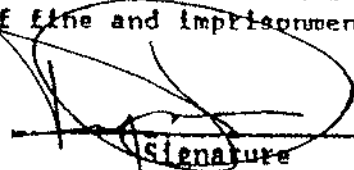
Signature
Seal

Certification by Executive Officer or Duly Authorized Representative

Name (Type or Print)

Title

Signature

Date

Ground Water Monitoring Well Certification
Form B - Location Certification

Name of Permittee: _____
Name of Facility: ALLIED BUILDING SUPPLY
Location: 101 W. ELIZABETH AVENUE, LINDEN, N.J.
LOT 10, BLOCK 254, TAX MAP
NJDES Number: NJ _____

Land Surveyor's Certification

Well Permit Number (as assigned by NJDEP's Water Allocation Section, 609-984-6831): _____

This number must be permanently affixed to the well casing

Longitude (one tenth of a second): _____ West 74° 15' - 12.6"
Latitude (one tenth of a second): _____ North 40° 37' - 45.3"
Elevation of Top of Casing (cap off) _____
(one hundredth of a foot): _____ Elev 29.23
Owners Well Number (as shown on the application of plans): _____

M.W. # 1

Hor. BASED ON NAD 1927

Vert. BASED ON UCGS 1929

Authentication

I certify under penalty of law that I have personally examined and am familiar with the information submitted in this document and all attachments and that, based on my inquiry of those individuals immediately responsible for obtaining the information, I believe the submitted information is true, accurate and complete. I am aware that there are significant penalties for submitting false information including the possibility of fine and imprisonment.

Professional Land Surveyor's Signature

DOMINICK J. VENDITTO, III
PROFESSIONAL LAND SURVEYOR
Professional Land Surveyor's Name
632 ASHWOOD AVENUE
ROSELLE PARK, NJ 07204
30093

Professional Land Surveyor's License #

Surveyor's Seal
NJDES # 30093

Ground Water Monitoring Well Certification
Form B - Location Certification

Name of Permittee: _____
Name of Facility: ALLIED BUILDING SUPPLY
Location: 101 W. ELIZABETH AVE, LINDEN, N.J.
LOT 10, BLOCK 254, TAX MAP
NJDES Number: NJ _____

Land Surveyor's Certification

Well Permit Number (as assigned by NJDEP's Water
Allocation Section, 609-984-6831): _____

This number must be permanently affixed to the
well casing


Longitude (one tenth of a second): West 74°-15'-12.3"
Latitude (one tenth of a second): North 40°-37'-45.1"
Elevation of Top of Casing (cap off)
(one hundredth of a foot): Elev 29.71
Owners Well Number (as shown on the
application of plans):

M.K.I. # 5

HORIZ. BASED ON NAD 1927
VERT. BASED ON USCG 1929

Authentication


I certify under penalty of law that I have personally examined and am familiar with the information submitted in this document and all attachments and that, based on my inquiry of those individuals immediately responsible for obtaining the information, I believe the submitted information is true, accurate and complete. I am aware that there are significant penalties for submitting false information including the possibility of fine and imprisonment.

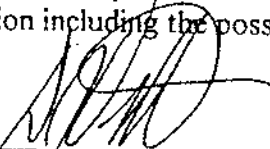

Professional Land Surveyor's Signature
DOMINICK J. VENDITTO, III
PROFESSIONAL LAND SURVEYOR
PROFESSIONAL PLANNER
632 ASHWOOD AVENUE
Professional Land Surveyor's Name
ROSELLE PARK, NJ 07204

30093

Professional Land Surveyor's License #

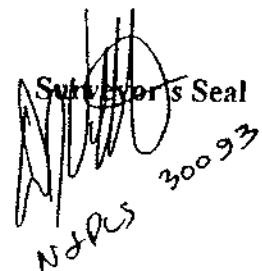
Surveyor's Seal
NJDES 30093

Ground Water Monitoring Well Certification
Form B - Location Certification

Name of Permittee: _____
Name of Facility: ALLIED BUILDING SUPPLY
Location: 101 W. ELIZABETH AVE., LINDEN, N.J.
LOT 10, BLOCK 254, TAX MAP
NJDES Number: NJ

Land Surveyor's Certification

Well Permit Number (as assigned by NJDEP's Water
Allocation Section, 609-984-6831): _____

This number must be permanently affixed to the
well casing

Longitude (one tenth of a second):

West 74°-15'-11.2"

Latitude (one tenth of a second):

North 40°-37'-44.3"

Elevation of Top of Casing (cap off)

(one hundredth of a foot):

Elev 30.60


Owners Well Number (as shown on the
application of plans):

M.K.I. # 6

HORIZ. BASED ON NAD 1927
VERT. BASED ON USCGS 1929


Authentication

I certify under penalty of law that I have personally examined and am familiar with the information submitted in this document and all attachments and that, based on my inquiry of those individuals immediately responsible for obtaining the information, I believe the submitted information is true, accurate and complete. I am aware that there are significant penalties for submitting false information including the possibility of fine and imprisonment.

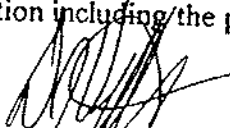

DOMINICK J. VENSETTO, III
PROFESSIONAL LAND SURVEYOR
PROFESSIONAL PLANNER
632 ASHWOOD AVENUE
ROSELLE PARK, NJ 07204
Professional Land Surveyor's Name

30093
Professional Land Surveyor's License #

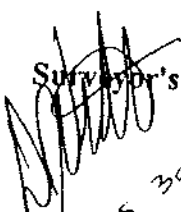

Surveyor's Seal
NJPLS 30093